



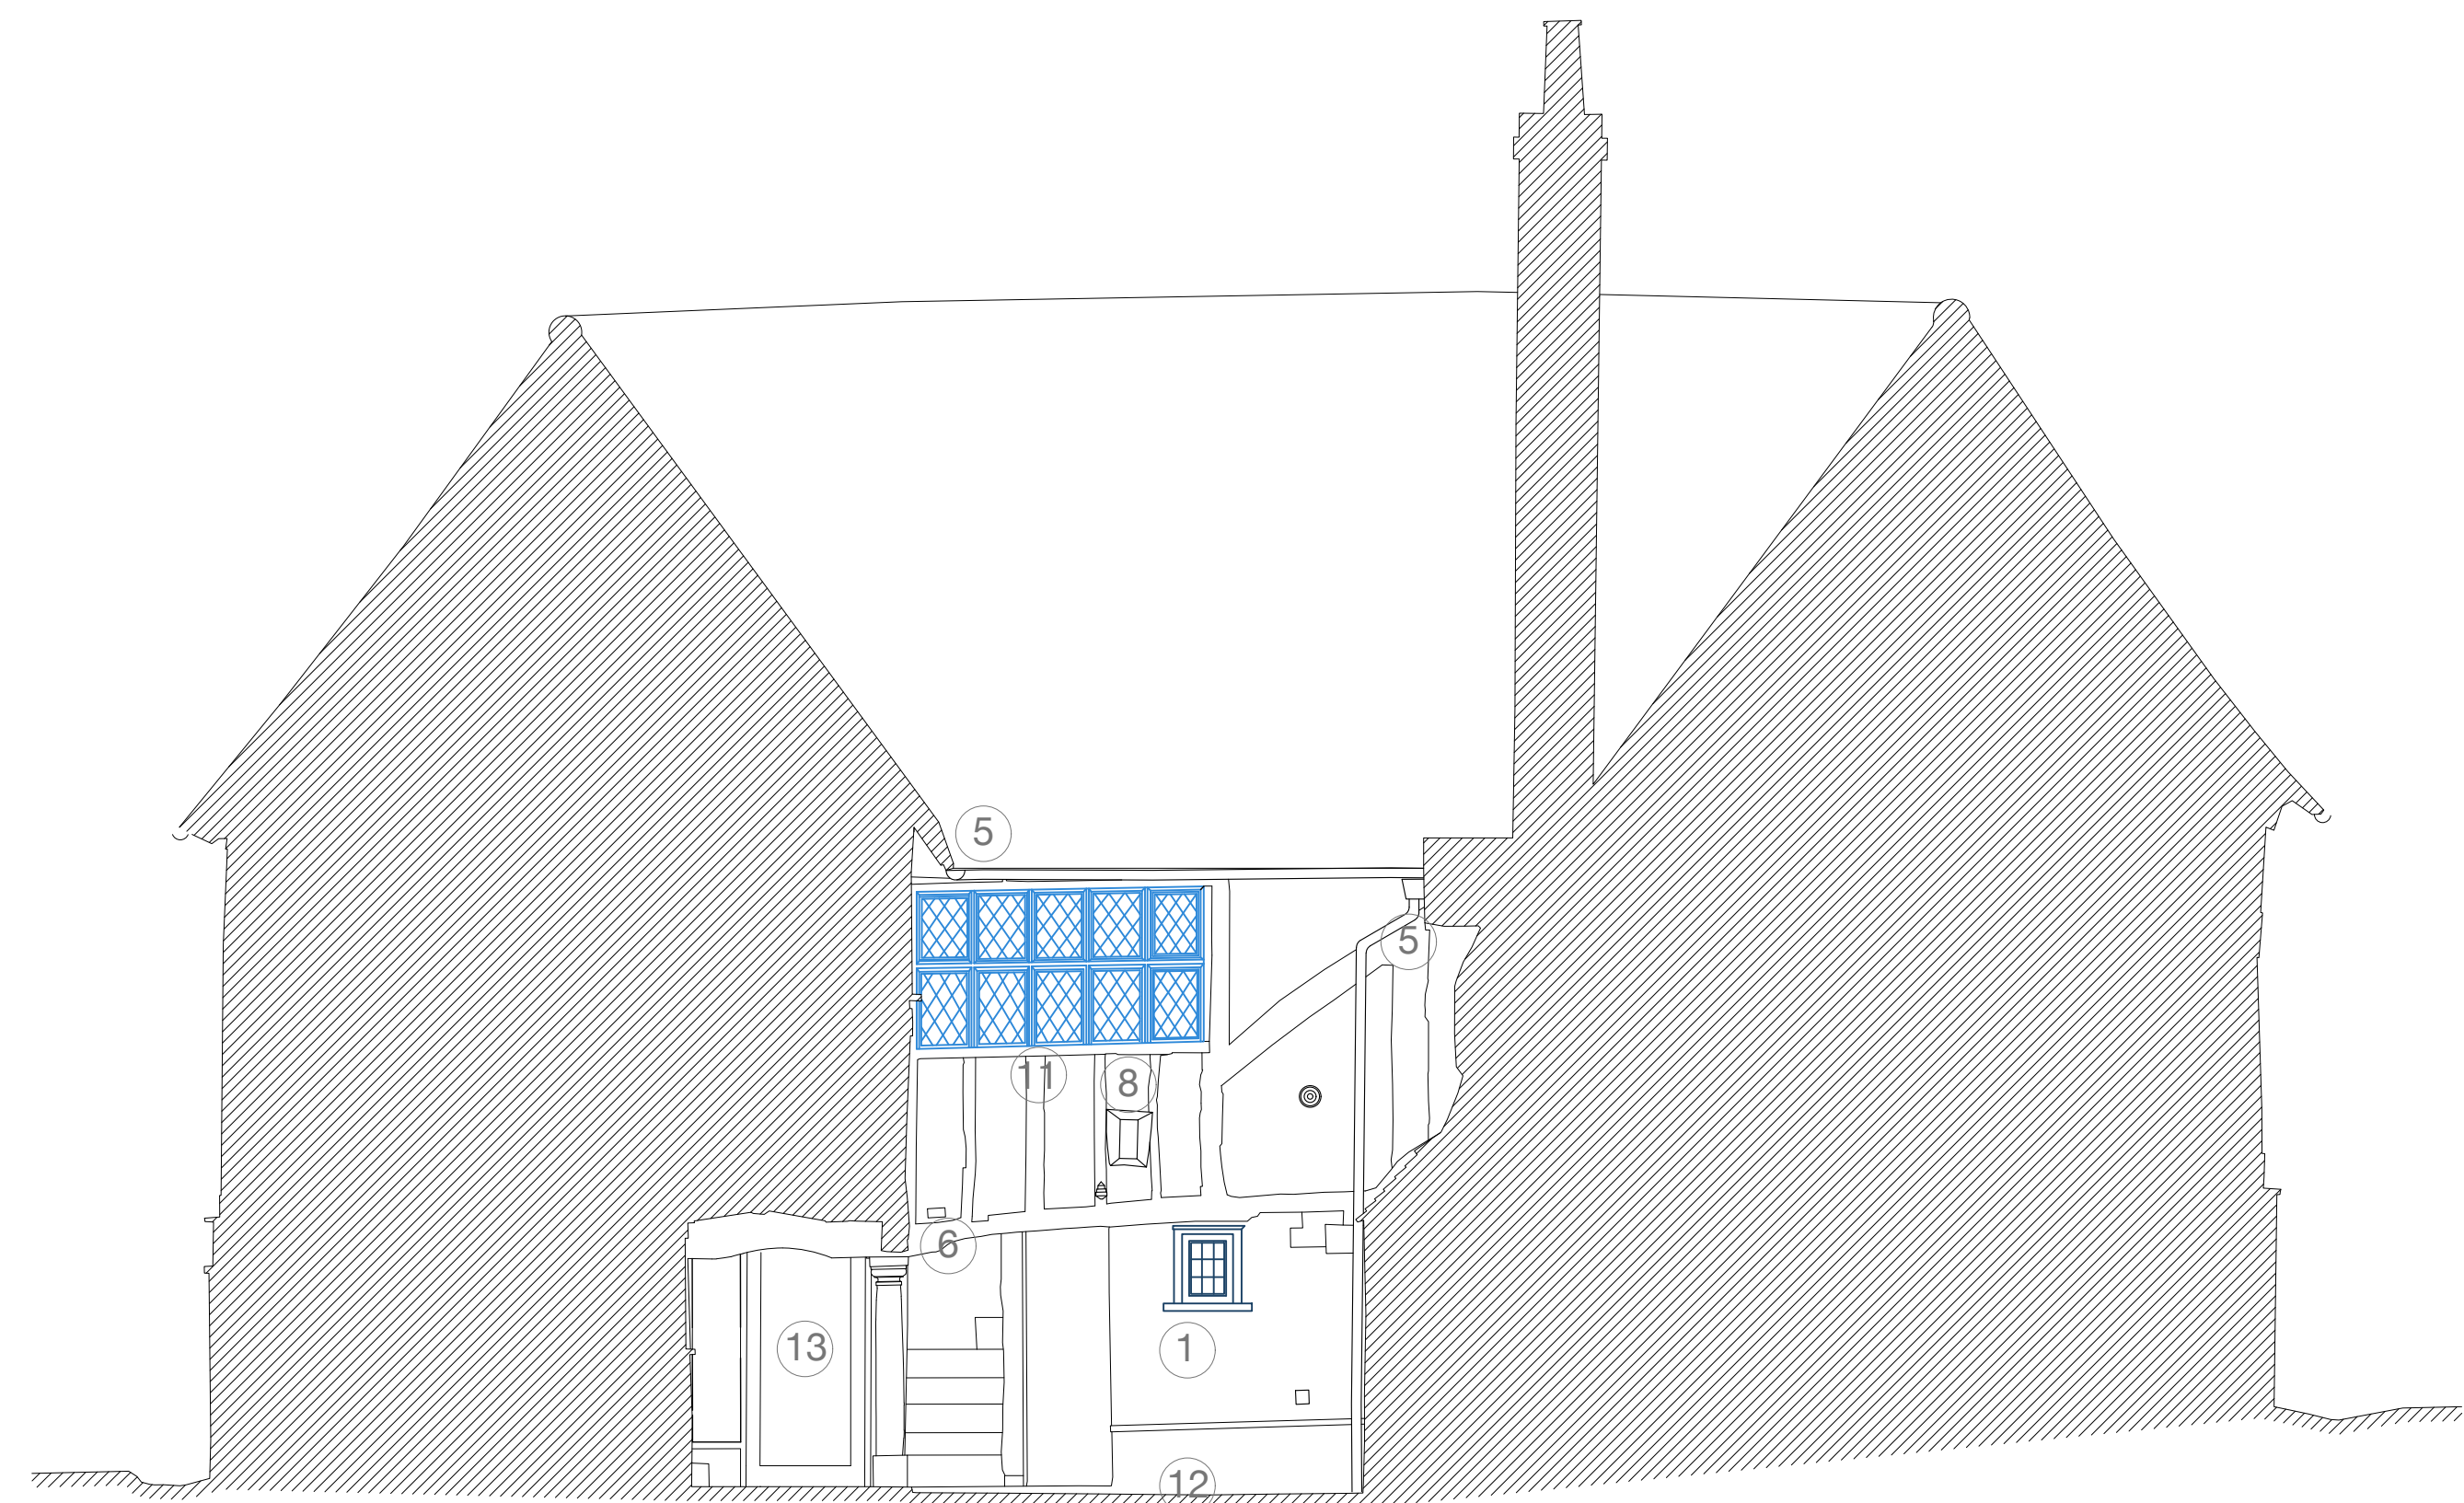

Courtyard South Facing Elevation, Proposed

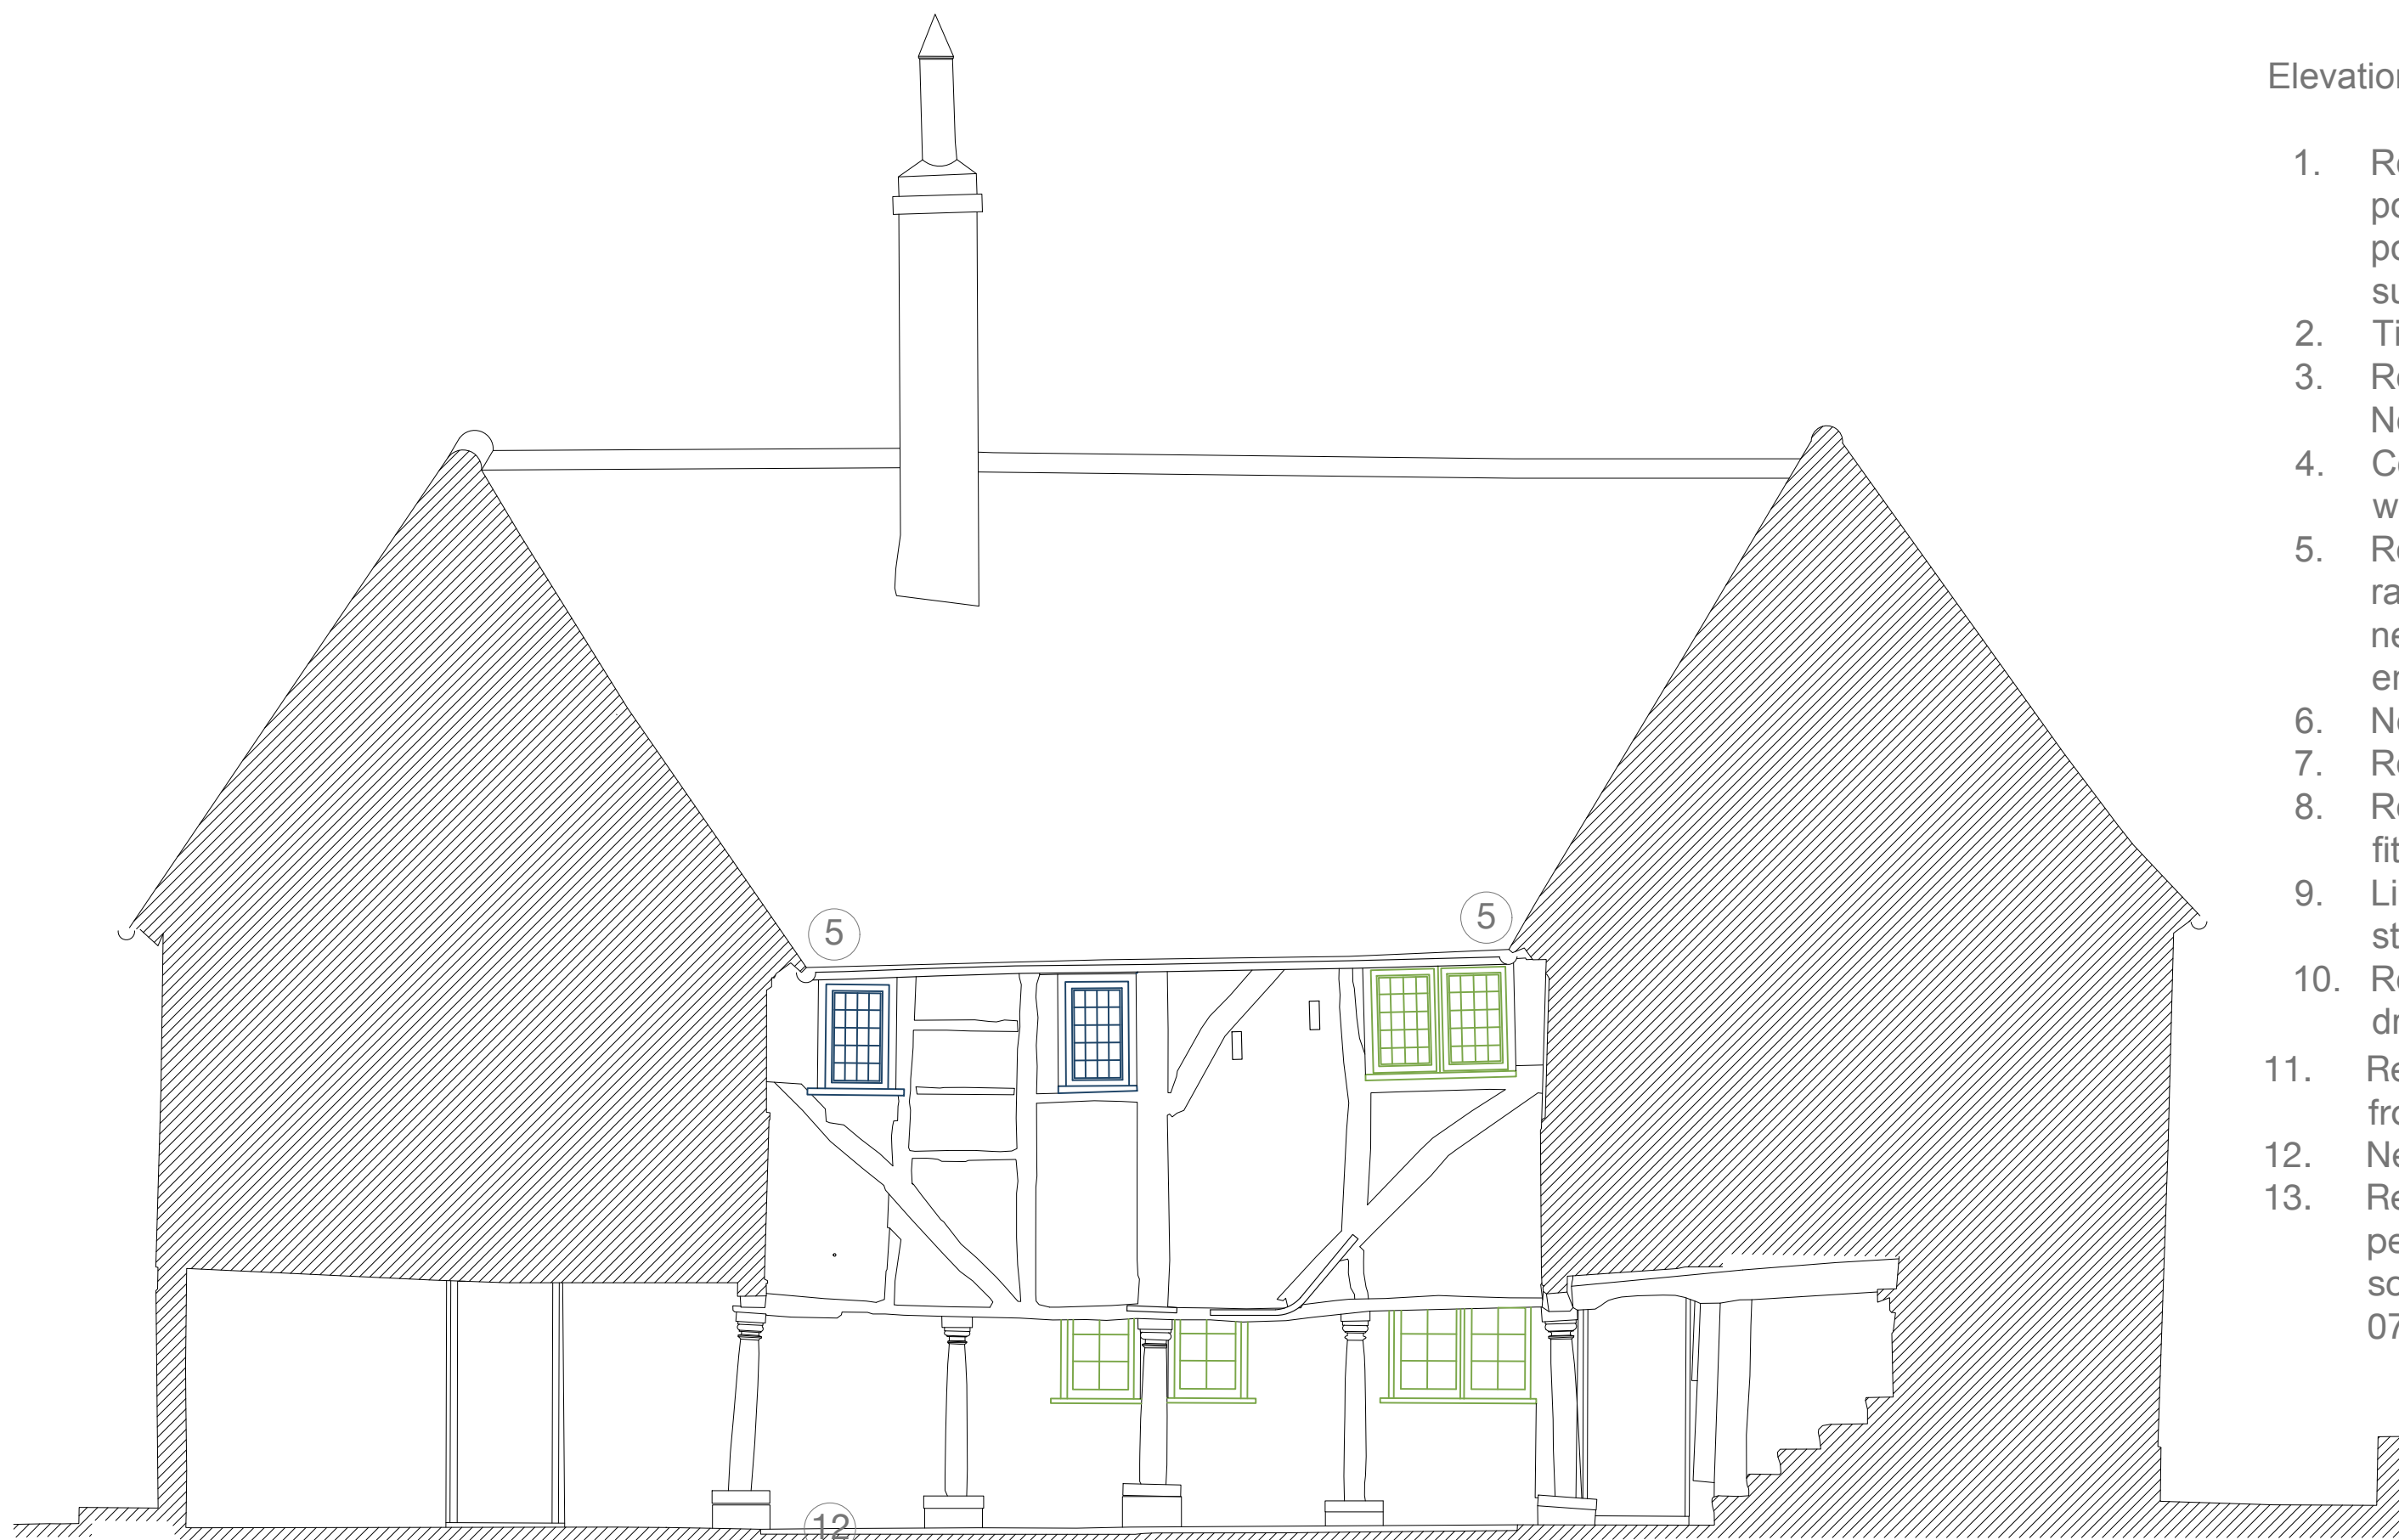

Courtyard East Facing Elevation, Proposed

Elevation works key:

1. Removal of cement pointing. New lime mortar pointing as per structural survey.
2. Timber repair
3. Removal of cement edging. New french drain.
4. Code 5 lead work to window heads
5. Repairs to existing rainwater goods: cast iron new joint spigots and end-stops
6. New bronze light fitting
7. Remove hedging
8. Removal of fixtures and fittings
9. Lintel works as per structural survey
10. Rectification of existing felt drip detail
11. Remove partition wall from WF-23
12. New permeable paving
13. Replacement door as per window and door schedule and drawing 070



Courtyard North Facing Elevation, Proposed



Courtyard West Facing Elevation, Proposed

Window Works Key:

- Retain, Repair, Introduce Slimline Glazing: treat damage and dry out moisture. Introduce slimline secondary glazing. Strip white paint subject to timber condition.
- Retain and Repair: Clean, repair any damage. Courtyard only.
- Replace: replace with double glazed dark hardwood frames rectangular leaded lights

Revisions:

Notes:

1. This drawing is copyright.
2. These layouts are preliminary until further surveys are undertaken.
3. Scale and boundaries are indicative.
4. Ownership boundary indicative based on OS data.
5. Red dotted line is shown as site boundary.
6. Elevation key plan not to scale.
7. Dimensions shown are indicative only and subject to survey

Second Floor, 99 Bancroft
Hitchin, SG5 1NQ
01462 236866
michael@michaelcollinsarchitects.com
www.michaelcollinsarchitects.com



Michael Collins Architect Ltd

The Biggin

Job No.
299 Internal Elevations
as Proposed

Stage: Stage 3
Status: For Information

033

REVISION:
R01 Scale
1:50 @A1